

## JOINT MESSAGEFORM

RESERVED FOR COMMUNICATION CENTER.

Approved For Release 2002/06/24 : CIA-RDP99B00048R000100240002-0

SECURITY CLASSIFICATION

S E C R E T

TYPE MSG

BOOK

MULTI

SINGLE

PRECEDENCE

ACTION ROUTINE

INFO ROUTINE

DTG

OUT 60466

FROM:

TO:

INFO:

SPECIAL INSTRUCTIONS

IDEALIST SCOPE SAINT III

REF: (IN 38751)

1. ON MISSION GT 69-385, B-2 CONFIG S/N 229 FAILED IN FLIGHT AFTER COMPLETING 1565 CYCLES OF AN APPROXIMATE 1908 CYCLE FLIGHT LINE.
2. POST FLIGHT INSPECTION REVEALED A FILM WRAP AROUND THE 9L METERING ROLLER. FURTHER INSPECTION REVEALED INCONSISTENT STACKING OF FILM ON THE 9L SUPPLY ROLL, I.E., THE UPPER LAYERS APPEARED NORMAL ON PREFLIGHT WITH FILM WOUND AGAINST THE INNER FLANGE. ON POST FLIGHT, FILM WAS RE TELESCOPED TOWARD THE OUTER FLANGE. MISTRACKING OF FILM DUE TO ABOVE ANOMALIES CAUSED FILM JAM
3. NO DAMAGE TO CONFIGURATION NOR COMPONENTS WERE FOUND. CONFIGURATION IS O.R..
4. FILM SPOOLS WERE INSPECTED UNDER NORMAL ESTABLISHED PROCEDURES, NO ANOMALIES NOTED.

END OF MESSAGE

DATE	TIME
31	
MONTH	YEAR
OCT	69
PAGE NO.	NO. OF PAGES
1	1

TYPED NAME AND TITLE

PHONE

SIGNATURE

D R A F T E R

R E L E A S E R

SECURITY CLASSIFICATION

S E C R E T

DIRECTOR OF MATERIAL

REGRADING INSTRUCTIONS

DD FORM 173  
NOV 63

REPLACES EDITION OF 1 MAY 55 WHICH MAY BE USED.

☆ GPO 1967-242-605